



5 Voorbaai Crescent, Bayview, Hartenbos
Tel.: (044) 695 0831

P.O. Box 35, Hartenbos, 6520
e-mail: jaco@testpro.co.za



Client:	Zec 4 (Pty) Ltd
	P.O Box 154
	Hartenbos
	6520
Attention:	Dreyer van Zyl, 0825716279

SOIL ANALYSIS TEST REPORT

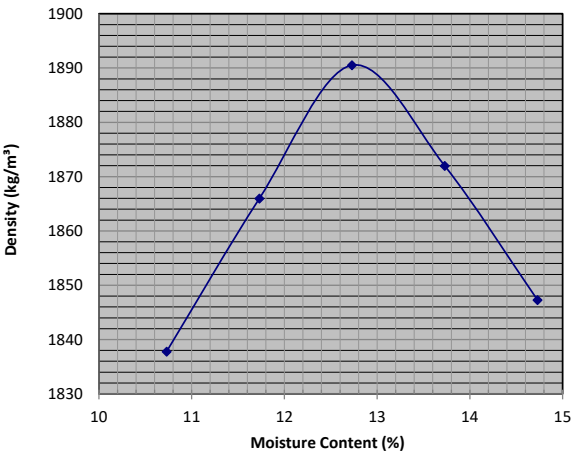
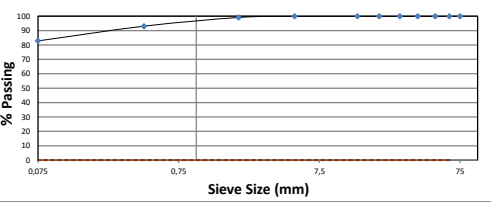
Job No:	TP18124
Order No:	-
Sample No:	2380
Project Information:	Phase 12 & 14 Outeniquasbosch
Number of pages:	2
Date Received:	25/01/2023
Date Sampled:	25/01/2023
Sampled by:	TESTPRO Laboratory
Sample plan included:	No
Environmental Conditions:	Hot / Sunny /
Delivered by:	TESTPRO Laboratory
Sampling method:	TMH5:MA2
Source of sample:	Test Pit 4 (Phase 14)
Condition of sample:	Good
Conformity statement requested by client:	Yes
Subcontractor (if any)	No
Material description:	Yellow & Brown Whitish Calc Sandy Clay
Tests Requested/Method:	SANS
	Grading SANS 3001-GR1
	Atterberg Limits SANS 3001-GR10 & -GR20
	M.D.D SANS 3001-GR30 & -GR20
	C.B.R. SANS 3001-GR40 & -GR20
Date Completed:	31/01/2023

Notes/Deviations

Remarks:

- All tests marked (#) are not included in our schedule of Accreditation.
- The results reported relate only to the sample tested. Statement of conformity are not made or implied in the report, unless required by the client. Review the results, expanded uncertainty, and specifications to ensure they meet your requirements.
The final decision rule will be the customers risk and not the Laboratory.
The Laboratory does not report a statement of conformity unless it is inherent in the requested specification or standard.
- This document is the correct record of all measurements made, and may not be reproduced other than with full written approval from the Technical Manager of TESTPRO Laboratory.
- Measuring equipment is traceable to national standards (Where applicable).
- Samples will be retained, for a one month period, before disposal.
- Tests are reported with an approximate 95% level of confidence.
- Uncertainty of measurement will only be reported if requested by the client.
- Opinions & Interpretations are not included in our schedule of Accreditation.

Technical Signatory
Jaco van Rensburg

 TESTPRO LABORATORY Materials Testing Laboratory				 sanas Testing Laboratory 10552			
5 Voorbaai Crescent, Bayview, Hartenbos Tel. : (044) 695 0831				P.O. Box 35, Hartenbos, 6520 e-mail : jaco@testpro.co.za			
Client:	Zec 4 (Pty) Ltd P.O Box 154 Hartenbos 6520			Date Reportec	02/02/2023	Job nr:	TP18124
Attention:	Dreyer van Zyl, 0825716279			Specification:	COLTO	Order no:	-
				Project:	Phase 12 & 14 Outeniquasbosch		
SOIL ANALYSIS TEST REPORT							
SAMPLE INFORMATION				MATERIAL PROPERTIES			
Material Description	Yellow & Brown Whitish Calc Sandy Clay			GRADING		G9	
Source	Test Pit 4 (Phase 14)	Position/ Layer	Layer 2	Sieve Size	% Passing	Specifications	Uncertainty
Date Received	25/01/2023	Date Tested	31/01/2023	75	100		Opinion
Sampling Method	TMH5:MA2	Sample Number	2380	63	100		✓ or X
MOD, BD & AD Analysis				50	100		
MDD	1891	kg/m ³	OMC	12,7			
BD	-		WA	-			
AD	-						
Method	Scalped	% Scalped	0,0				
Uncertainty				37,5	100		
MDD		kg/m ³	OMC				
				SIEVE ANALYSIS			
							
				Test	Results	Specifications	Opinion
				Grading Modulus	0,3	0.75<2.7	✗
				Coarse Sand Ratio	6	N/A	
				Strength (kN)			
				10% FACT (Dry)		Mudrock Only	
				10% FACT (Wet)			
				Wet/Dry Rel. (%)			
				CBR			
Moulding MC%	12,7						
CBR @ 98%	2						
CBR @ 97%	2						
CBR @ 95%	1						
CBR @ 93%	1	Min 7	✗				
CBR @ 90%	1						
Swell							
Swell @ 100%	6,3	Swell<1.5%	✗				
Durability (%)							
ACV (Dry)							
ACV (Wet)							
Flakiness Index							
20mm<28mm							
14mm<20mm							
Atterberg Limits							
-0.425mm							
Liquid Limit	46						
Plastic Limit	21						
Linear Shrinkage	10,0						
LSx%Pass0.425	931						
Plasticity index	26	Max 12	✗				
-0.075mm							
Liquid Limit	-						
Plastic Limit	-						
Linear Shrinkage	-						
Plasticity index	-						
Classification:	<G9						
							
Fractured Faces							
Size	Fractured Faces %	Size	Fractured Faces %				
37,5		14					
28		5					
20		All>5					
#N/A							
☒ In Spec ☒ Out of Spec ☐ Even with a 95% certainty, reading could be out of spec. ☐							
Technical Signatory Jaco van Rensburg							